




## FRONT MOUNT ADAPTER

# SEGWAY

## Snarler

Code 03.12400

Version 13112023

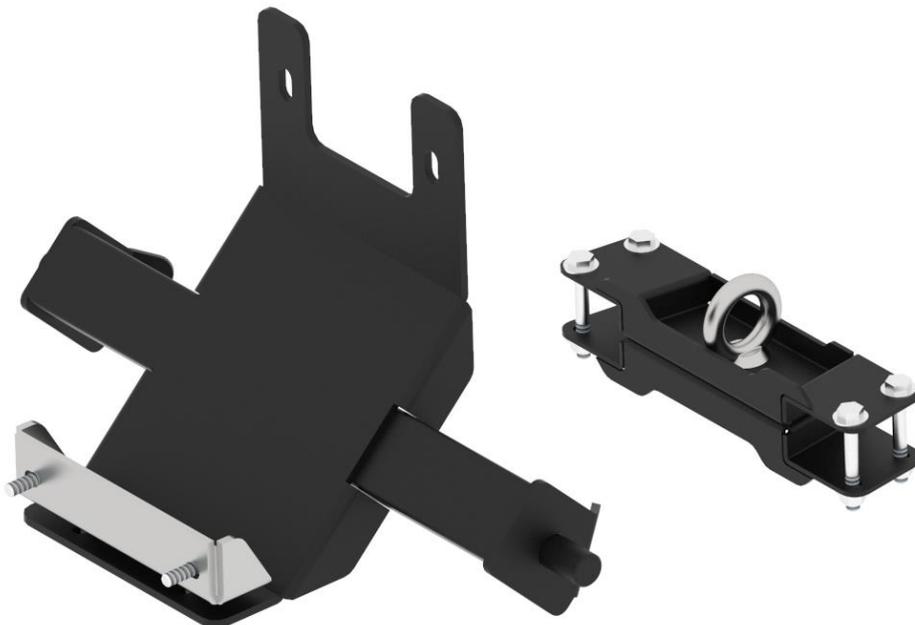


**Keep this manual for future reference!**

If you need any spare parts, please send this packaging data to your local dealer or to Iron Baltic  
[sales@ironbaltic.com](mailto:sales@ironbaltic.com)

# SPECIFICATION

Pos.	Description	Code	Amount
1	Snow plow adapter	03.12401K	1
2	Lower bracket	03.12405	1
3	Lifting plate	03.12406	2
4	Distance bush	05.5405	2
5	Lifting eye bolt M12 DIN580	OT.19.01.010	1
6	Bolt M8x20 DIN933	OT.02.02.180	2
7	Bolt M8x30 DIN933	OT.02.02.200	2
8	Bolt M8x60 DIN931	OT.02.01.015	4
9	Washer Ø8/20 SFS3738	OT.04.03.030	12
10	Washer M12 DIN125	OT.04.01.050	1
11	Nyloc nut M8 DIN985	OT.03.02.040	4
12	Nyloc nut M12 DIN985	OT.03.02.060	1

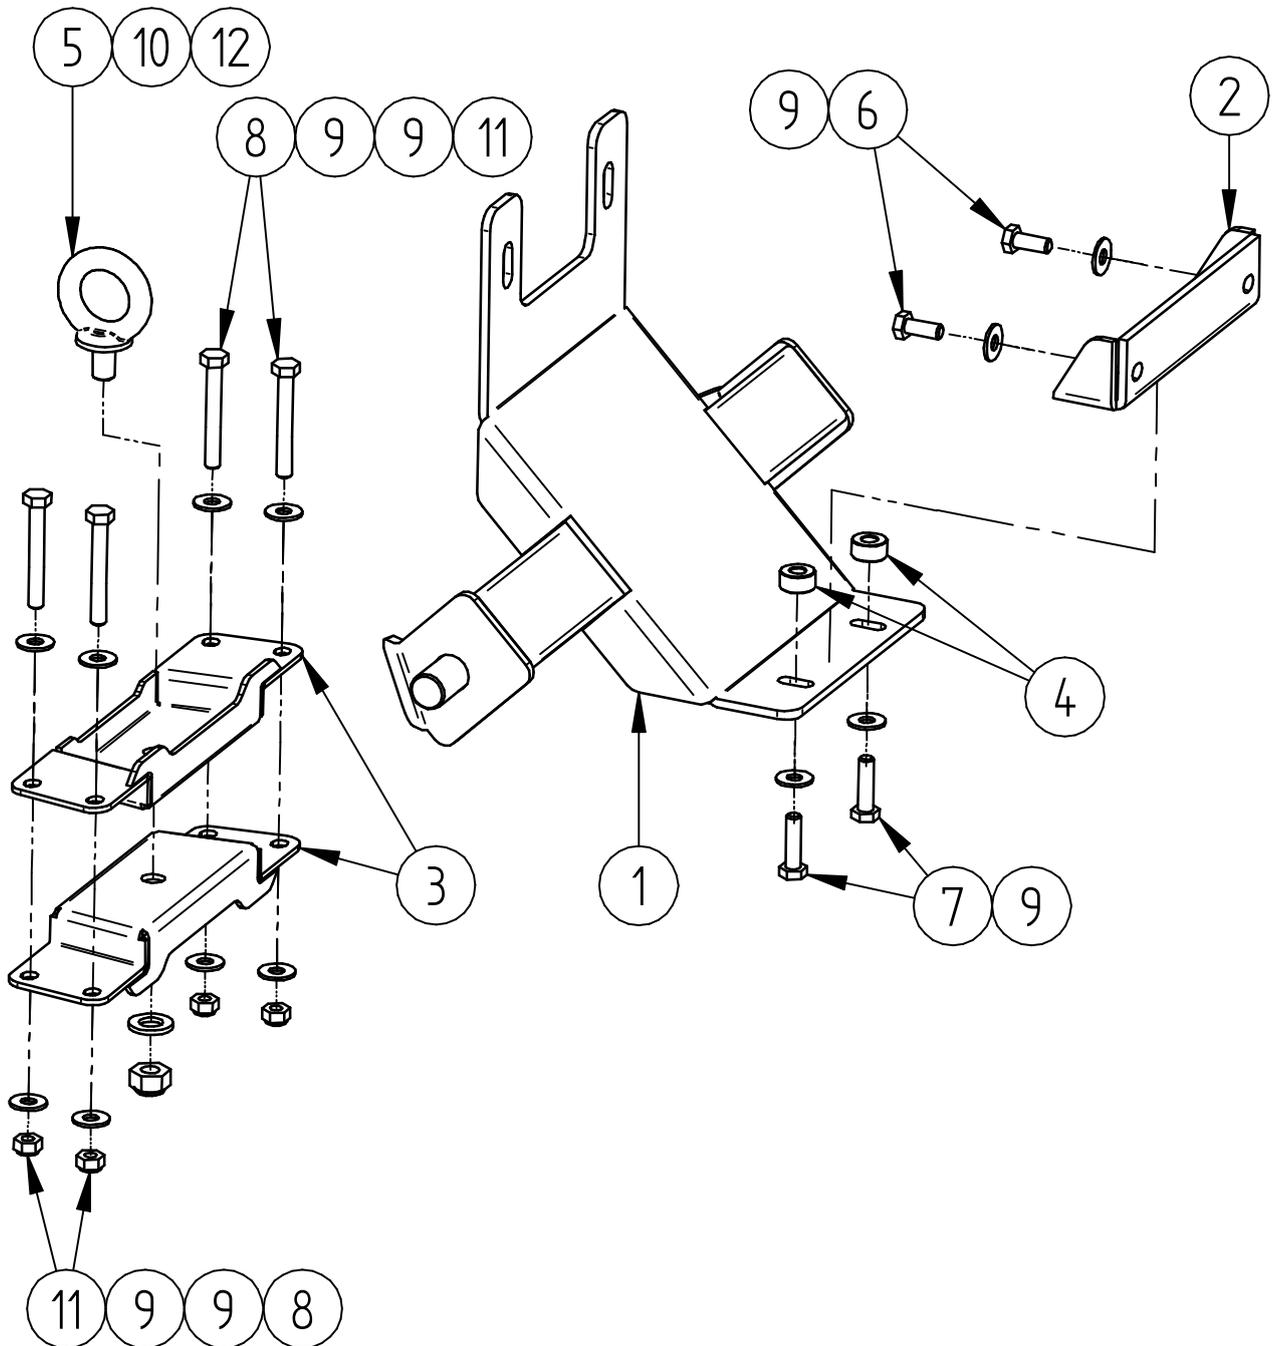

# FITTING INSTRUCTIONS



## Step 1

Remove winch fairlead and the plastic on the front of the ATV. When using the Iron Baltic skid plate, then remove the skid plate front part and reinforcement from the front part.




## Step 2

Install lower bracket (Pos.2). For fastening use M8x20 bolts (Pos.6) and Ø8 mm washers (Pos.9).

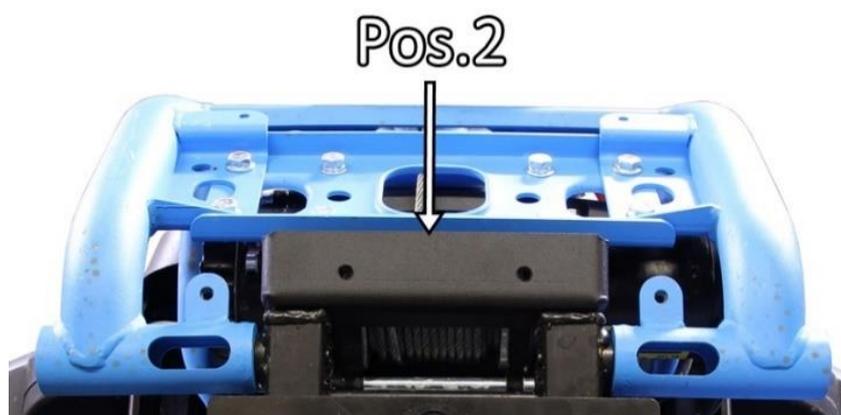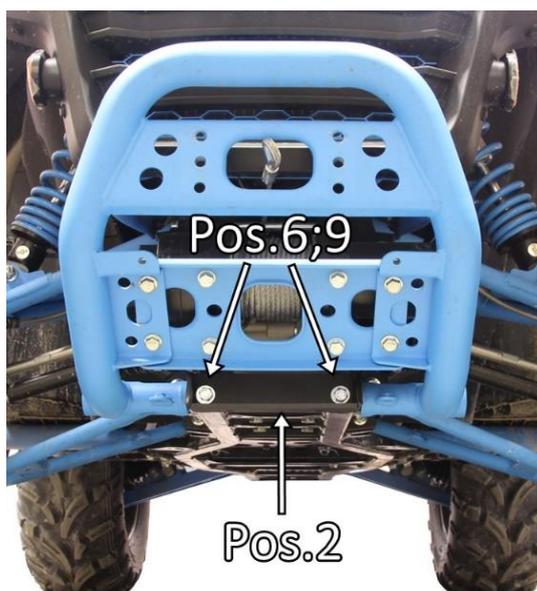



### Step 3

Reinstall front plastic / skid plate front part. When installing adapter with original front plastic, make the cut-outs to it for installing the adapter lower bolts.

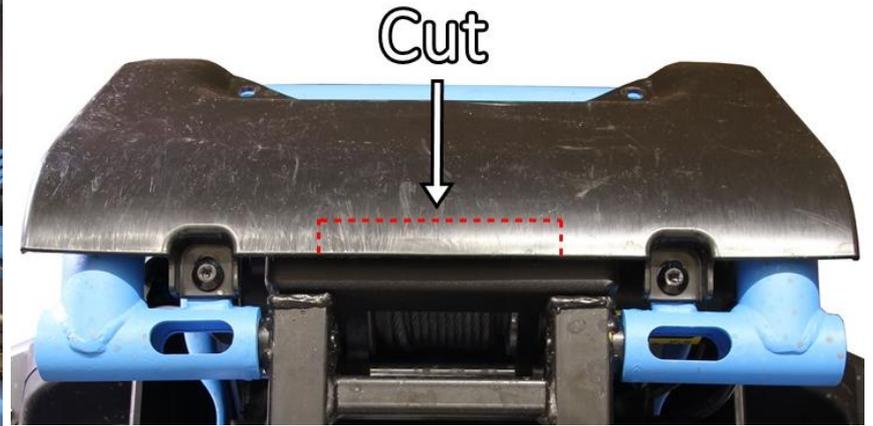


### Step 4

Install adapter (Pos.1) together with winch fairlead. For fastening use fairlead original bolts, M8x25 bolts (Pos.6) and Ø8 mm washers (Pos.8).  
NB! If you are installing adapter with original skid plate, then install distance bushes (Pos.4) between the adapter (Pos.1) and lower bracket (Pos.2). When installing with Iron Baltic skid plate then distance bushes are not needed!

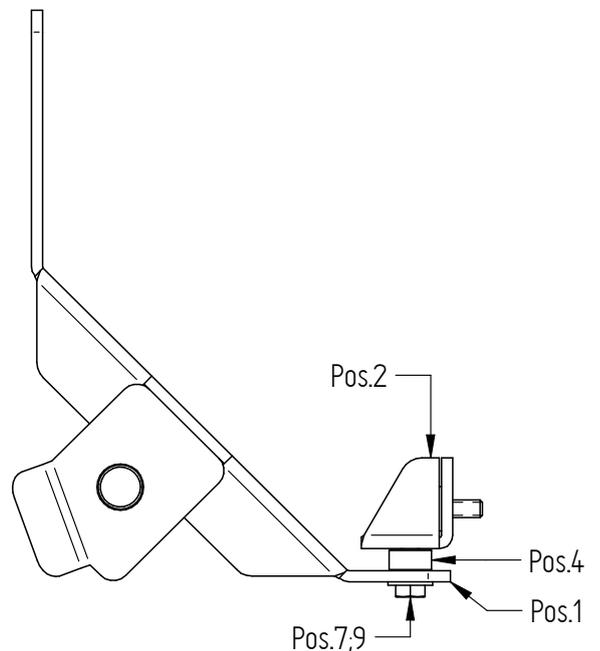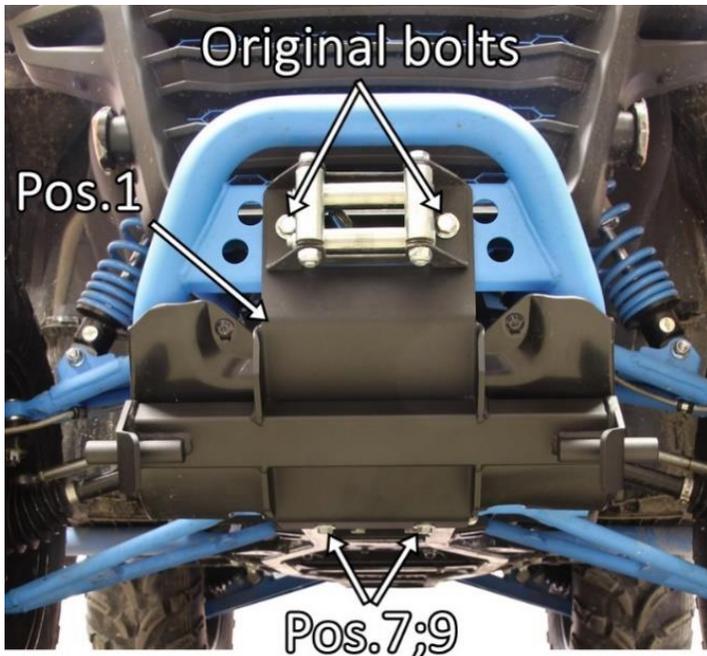

## Step 5

Install lifting plates (Pos.3) to the snow plow frame and lifting eye bolt (Pos.5) to lifting plate. For fastening the lifting plates use M8x60 bolts (Pos.8), Ø8 mm washers (Pos.9) and M8 nyloc nuts (Pos.11). For fastening the lifting eye use Ø12 mm washer (Pos.10) and M12 nyloc nuts (Pos.12).

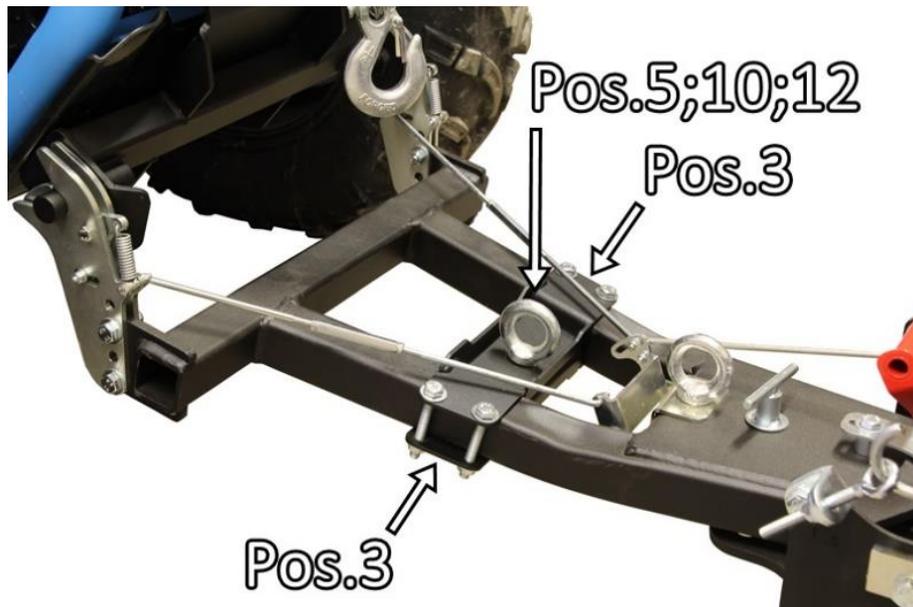



# IRON BALTIC

IRON BALTIC OÜ  
Joa tee 17  
Vääna 76903  
Estonia / Europe

+372 6 533 711  
[sales@ironbaltic.com](mailto:sales@ironbaltic.com)

[www.ironbaltic.com](http://www.ironbaltic.com)  
[www.facebook.com/ironbaltic](https://www.facebook.com/ironbaltic)  
[www.youtube.com/user/ironbalticLtd](https://www.youtube.com/user/ironbalticLtd)

